



- Three phase highest-up AC Current Transducer
- Precision true RMS class 0,5 measurement, not affected by any waveform distortion
- For use with 1A or 5A current transformers
- Up to two individual very fast analogue output signals (<50mS), (optional)
- DIN96 Slave Indicator with full current scale (optional)

Specifications

Standard Auxiliary Voltage:	100-120V, 200-240V, 380-415V, 440-460V, 480VAC, 40-70Hz (Fuse 0,5A)
Optional Auxiliary Voltage:	24-60VDC (Fuse 0,5A) 110-220VDC (Fuse 1A)
Supply tolerance:	+10%, -20%
Power rating:	5VA
Current Input:	1A CT or 5A CT, <0,1VA
Ampere range:	Any % of the CT value
Analogue output 1: (see page 2 for available outputs)	mA: Up to 20mA, max 500R V: Up to 10V, min 100kohm (other on request)
Analogue output 2: (see page 2 for available outputs)	mA: Up to 20mA, max 500R V: Up to 10V, min 500ohm (other on request)
Accuracy:	Class 0,5
Temperature:	-20 to +70°C
Humidity, relative:	0-95%
Weight:	0.6kgs
Front protection:	IP21
Flammability:	UL94-V0

Description

The digitally controlled MCCSAX is for use in applications that require a very fast response, precision monitoring of a single phase AC current. Ideal for systems for regulation and control of the current load on generators, motors and inverters.

The MCCSAX is a precision three phase 3- and 4-wire highest up current measuring transducer for 1A or 5ACT input.

The unit measures the voltage and current true r.m.s. value, and accuracy is independent of any wave form distortion. A green LED (ON) indicates the auxiliary supply presence.



Up to two individual very fast analogue output signals (optional) proportional the highest of the three measured currents. (see page 2 for available outputs). The analogue output is isolated from the CT and auxiliary power.

The standard model have one output signal, but optional model have two output signals.

If an output is used for remote meter reading, we recommend 0-1mA for the slave indicator.

It also includes an additional RJ12 output for a DIN96 Slave Indicator (optional).


The noise-immune mA output is isolated from both the C.T. and voltage inputs and auxiliary power.

Models	O/P 1	O/P 2	Standard model	Optional model
MCCSAA	X	-	X	-
MCCSAB	X	X	-	X


The unit meets EN 60255-27 Cat. III, Pollution degree 2 and the relevant environmental and EMC tests specified in EN 60255-26 to comply with the requirements of the major Classification Societies.

Connection Diagram

Connection Diagram without optional slave instrument

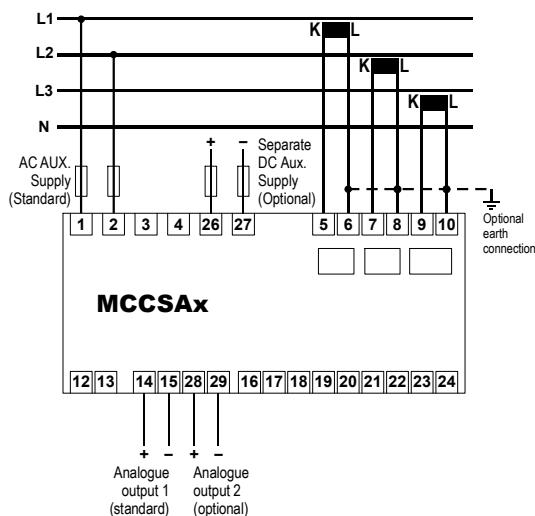

Connection Diagram with optional slave instrument

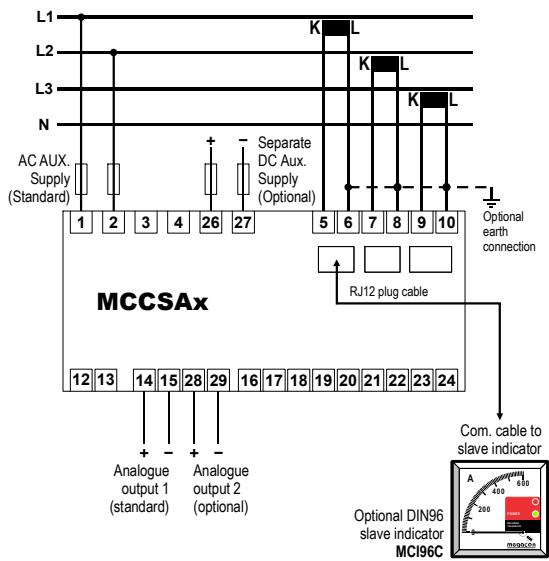

Analogue Output

The output signals are proportional to the meter reading (see page 1 for an overview of models and functions).

The signal is specifically intended as an input to a control system for monitoring or control.

Add suffix from table below to type designation to specify output required:

Outputs 1

O/P1	0 - 10mA
O/P2	0 - 20mA
O/P3	4 - 20mA
O/P4	N/A
O/P5	N/A
O/P6	N/A
O/P7	N/A
O/P8	0 - 10V
O/P9	0.2 - 10V
O/P10	4.3 - 20mA

Outputs 2

O/P11	0 - 10mA
O/P12	0 - 20mA
O/P13	4 - 20mA
O/P14	N/A
O/P15	N/A
O/P16	N/A
O/P17	N/A
O/P18	0 - 10V
O/P19	0.2 - 10V
O/P20	4.3 - 20mA

Connection

Terminal type : Terminal Clamp and Screw
Wire max. : T1-T4,

T26-T27: AWG 24-14,
T5-T10: AWG 12,
other terminals: AWG 24-12

: 0.5Nm


Overload

Voltage : 1.2 x Un continuous
2 x Un for 10secs


Current

: 2.5 x In continuous
5 x In for 1secs (max 25A)

Dimensions

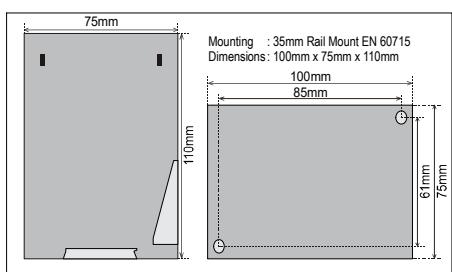

Slave Indicator		
DIN96	A 96 x 96mm	B 92 x 92mm

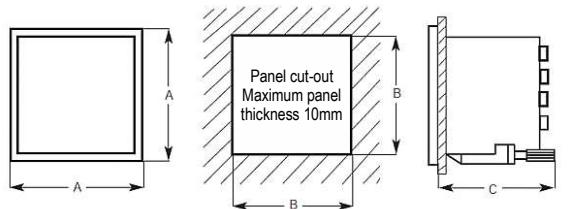

The MEGACON policy is one of continuous improvement, consequently equipment supplied may vary in detail from this publication.

ORDERING INFORMATION (Example)

Type	: MCCSAB
Aux. Supply	: 200-240VAC
Input Current C.T.	: 1500/5A
Range	: 0-1500A
Analogue output 1	: O/P3: 4-20mA
Analogue output 2	: O/P18: 0-10VDC

